



[4910-13-P]

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

**[Docket No. FAA-2017-1079; Product Identifier 2017-CE-039-AD; Amendment 39-19206; AD 2018-04-10]**

**RIN 2120-AA64**

**Airworthiness Directives; Pilatus Aircraft Limited Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final Rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for Pilatus Aircraft Limited Model PC-7 airplanes. This AD results from mandatory continuing airworthiness information (MCAI) issued by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as the brakes remaining activated after release of the brake pedal. We are issuing this AD to require actions to address the unsafe condition on these products.

**DATES:** This AD is effective [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

**ADDRESSES:** You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-1079; or in person at Docket Operations, U.S. Department of Transportation, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

For service information identified in this AD, contact PILATUS Aircraft Ltd., Customer Technical Support (MCC), P.O. Box 992, CH-6371 Stans, Switzerland; phone: +41 (0)41 619 67 74; fax: +41 (0)41 619 67 73; email: techsupport@pilatus-aircraft.com; Internet: <http://www.pilatus-aircraft.com>. You may review this referenced service information at the FAA, Policy and Innovation Division, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. It is also available on the Internet at <http://www.regulations.gov> by searching for Docket No. FAA-2017-1079.

**FOR FURTHER INFORMATION CONTACT:** Doug Rudolph, Aerospace Engineer, FAA, Small Airplane Standards Branch, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4059; fax: (816) 329-4090; email: [doug.rudolph@faa.gov](mailto:doug.rudolph@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Discussion**

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to Pilatus Aircraft Limited Model PC-7 airplanes. The NPRM was published in the *Federal Register* on November 21, 2017 (82 FR 55332). The NPRM proposed to correct an unsafe condition for the specified products and was based on mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country. The MCAI states:

This [FOCA] Airworthiness Directive (AD) is prompted due to a report where the brakes have remained activated after release of the brake pedals before taxing.

Such a condition, if left uncorrected, could lead to an asymmetric braking and subsequent loss of directional control.

In order to correct and control the situation, this [FOCA] AD requires the modification of the brake-pedal interconnecting tie-rod by removing the bonding straps and attachment hardware currently installed on the left and right brake-pedal interconnecting tie-rods.

The MCAI can be found in the AD docket on the Internet at:  
<https://www.regulations.gov/document?D=FAA-2017-1079-0002>.

### **Comments**

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM or on the determination of the cost to the public.

### **Conclusion**

We reviewed the relevant data and determined that air safety and the public interest require adopting the AD as proposed except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

### **Related Service Information under 1 CFR part 51**

We reviewed Pilatus Service Bulletin No. 32-028, dated September 20, 2017. The service bulletin describes procedures for removing the left and right brake pedal interconnecting tie rods. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section of the AD.

### **Costs of Compliance**

We estimate that this AD will affect 18 products of U.S. registry. We also estimate that it would take about 2.5 work-hours per product to comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour.

Based on these figures, we estimate the cost of the AD on U.S. operators to be \$3,825, or \$212.50 per product.

### **Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to small airplanes, gliders, balloons, airships, domestic business jet transport airplanes, and associated appliances to the Director of the Policy and Innovation Division.

### **Regulatory Findings**

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this AD:

(1) Is not a "significant regulatory action" under Executive Order 12866,

(2) Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),

(3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### **Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-1079; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains the NPRM, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations (telephone (800) 647-5527) is in the ADDRESSES section. Comments will be available in the AD docket shortly after receipt.

### **List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### **Adoption of the Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### **PART 39 - AIRWORTHINESS DIRECTIVES**

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

#### **§ 39.13 [Amended]**

2. The FAA amends § 39.13 by adding the following new AD:

2018-04-10 **Pilatus Aircraft Limited:** Amendment 39-19206; Docket No. FAA-2017-1079; Product Identifier 2017-CE-039-AD.

**(a) Effective Date**

This airworthiness directive (AD) becomes effective [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Pilatus Aircraft Limited Model PC-7 airplanes, manufacturer serial numbers 101 through 618, certificated in any category.

**(d) Subject**

Air Transport Association of America (ATA) Code 32: Landing Gear.

**(e) Reason**

This AD was prompted by mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as the brakes remaining activated after release of the brake pedal. We are issuing this AD to prevent the brakes from remaining activated after the brake pedal has been released, which could lead to asymmetric braking and subsequent loss of control.

**(f) Actions and Compliance**

Unless already done, within the next 90 days after the effective date of this AD, modify the brake pedal interconnecting tie rods by removing the bonding straps and attachment hardware following sections A, B, and C of the Accomplishment Instructions in Pilatus Service Bulletin 32-028, dated September 20, 2017.

**(g) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Small Airplane Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Doug Rudolph,

Aerospace Engineer, FAA, Small Airplane Standards Branch, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4059; fax: (816) 329-4090; email: doug.rudolph@faa.gov. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, Small Airplane Standards Branch, FAA; or the Federal Office of Civil Aviation (FOCA), which is the aviation authority for Switzerland.

**(h) Related Information**

Refer to MCAI FOCA AD HB-2017-002, dated October 20, 2017, for related information. The MCAI can be found in the AD docket on the Internet at: <https://www.regulations.gov/document?D=FAA-2017-1079-0002>.

**(i) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Pilatus Service Bulletin 32-028, dated September 20, 2017.

(ii) Reserved.

(3) For service information identified in this AD, contact PILATUS Aircraft Ltd., Customer Technical Support (MCC), P.O. Box 992, CH-6371 Stans, Switzerland; phone: +41 (0)41 619 67 74; fax: +41 (0)41 619 67 73; email: [techsupport@pilatus-aircraft.com](mailto:techsupport@pilatus-aircraft.com); Internet: <http://www.pilatus-aircraft.com>.

(4) You may view this service information at the FAA, Policy and Innovation Division, 901 Locust, Kansas City, Missouri 64106. For information on the availability of

this material at the FAA, call (816) 329-4148. In addition, you can access this service information on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-1079.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to:

<http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on February 16, 2018.

Pat Mullen,  
Acting Deputy Director, Policy & Innovation Division,  
Aircraft Certification Service.  
[FR Doc. 2018-04267 Filed: 3/7/2018 8:45 am; Publication Date: 3/8/2018]